


T568B Wiring Scheme

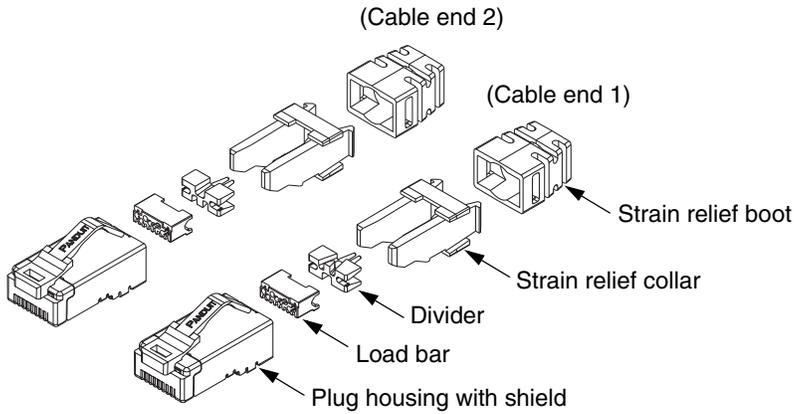


Pin #	8	7	6	5	4	3	2	1
T568B	BRN	BRN/ WHT	GRN	BLU/ WHT	BLU	GRN/ WHT	ORG	ORG/ WHT

Specifications

- Cable jacket diameter maximum 0.300 in (7.6mm).
- Solid or stranded conductor maximum insulated diameter 0.047 in (1.2mm).
- Panduit recommends T568B wiring scheme for use with cable constructed with the brown pair opposing the orange pair.
- For use with F/UTP, U/FTP and S/FTP type cables, which meet the dimensional requirements. Cable must have drain wire or braid.


Load Bar

Conductor holes and contact slots


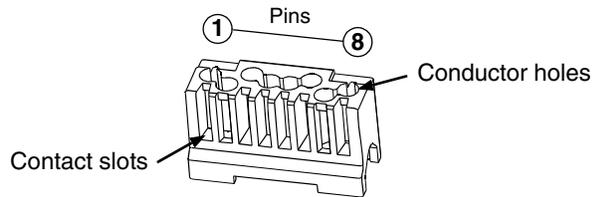


Divider



Conductor slots and "V" channel

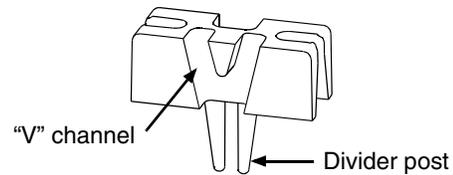



- 1** Thread on boot and collar first!
(Cable ends 1 & 2)

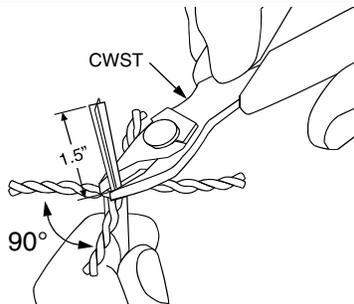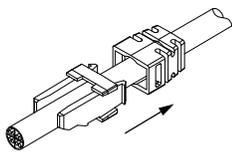


- Thread boot and collar onto cable.
- Remove 1.5" of the outer jacket using wire stripping tool (CJAST).
- Cut foil flush with cable jacket. If cable is braided, form braid into a drain wire. Bend the drain wire back so it is against the cable jacket.
- Fan twisted pairs into respective quadrants. The brown pair should be opposite the orange pair.
- Cut spline flush to fanned pairs using wire snipping tool (CWST).

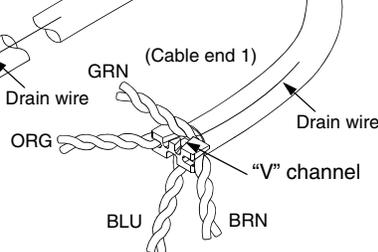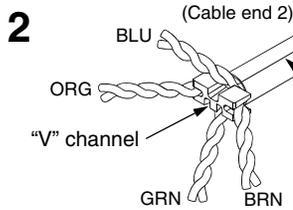


- Align the conductor divider "V" channel with the green pair.
- Insert divider posts into the cable. If the cable has an internal spline, insert divider posts into the brown and orange quadrants of the spline.

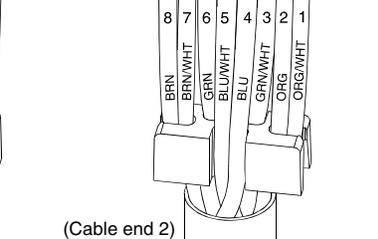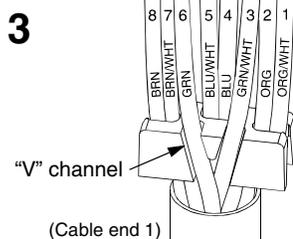


- Arrange conductors to T568B wiring scheme while minimizing untwist.
- Seat conductors into proper divider slots while holding divider flush with cable jacket.

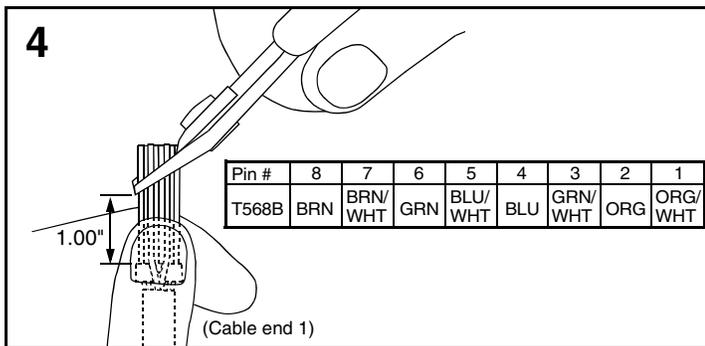


- Straighten and align untwisted conductors using a circular motion while holding conductors in respective divider slots.
- Maintain grip of conductors in T568B wiring scheme.
- Trim conductors on an angle approximately 1.00" from divider leading edge.

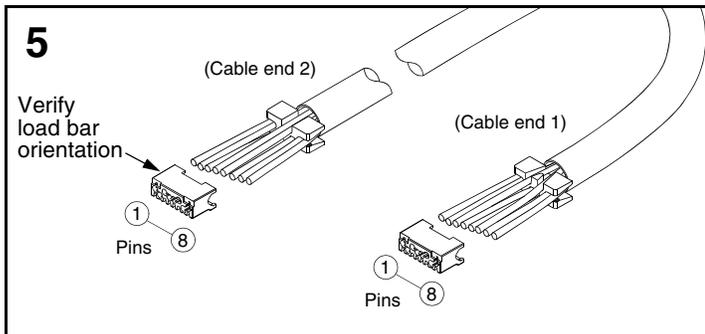


- Orient load bar with contact slots facing downward.

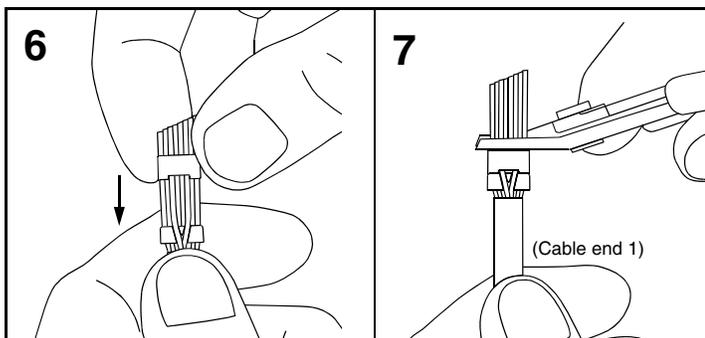

- Guide conductors into load bar holes while holding conductors in the divider.
- Slide load bar towards divider until flush.
- Ensure the divider/load bar is centered and perpendicular to the cable axis.
- Trim conductors flush with load bar face.

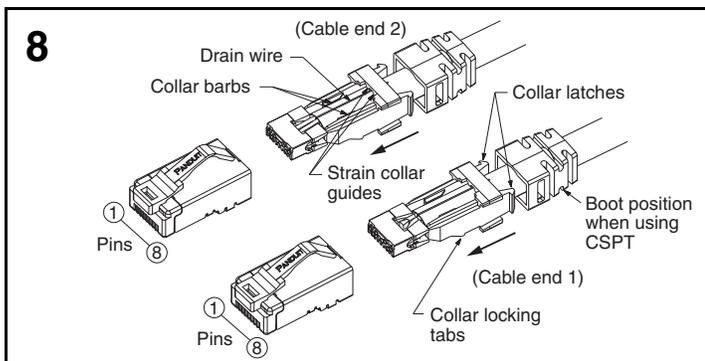


- Orient cable so the drain wire is facing up.
- Hold the load bar and divider stationary while sliding the strain relief collar forward until there is no gap between the collar and divider.
- Ensure the drain wire is routed through the strain collar guides.
- Confirm the cable jacket extends beyond the collar bars.
- Align pin #1 of cable sub-assembly (cable, load bar, divider, and strain relief collar) with pin #1 of plug housing.

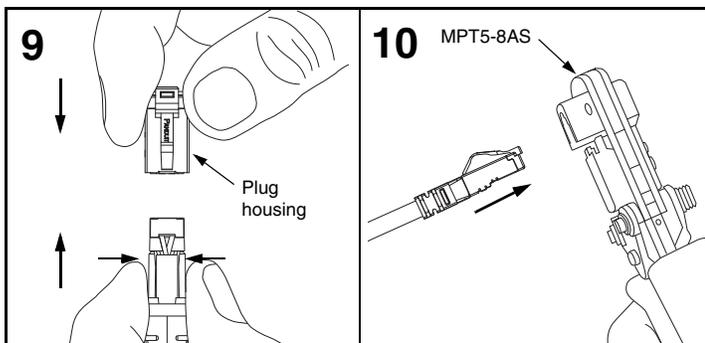

- Grip the strain relief collar and insert cable sub-assembly into the plug housing. (Fig. 9)
- Push sub-assembly into housing until collar locking tabs engage the plug housing pocket. Although not required, TX6 PLUS Plug Assembly Tool (CSPT) is available to facilitate this step.
- Use tool MPT5-8AS to complete plug termination. (Fig. 10)
- Trim or press excess drain wire between the collar latches.
- Push up boot and engage with collar latches.
- Visually check plug. Assembly is complete.

T568A Wiring Scheme

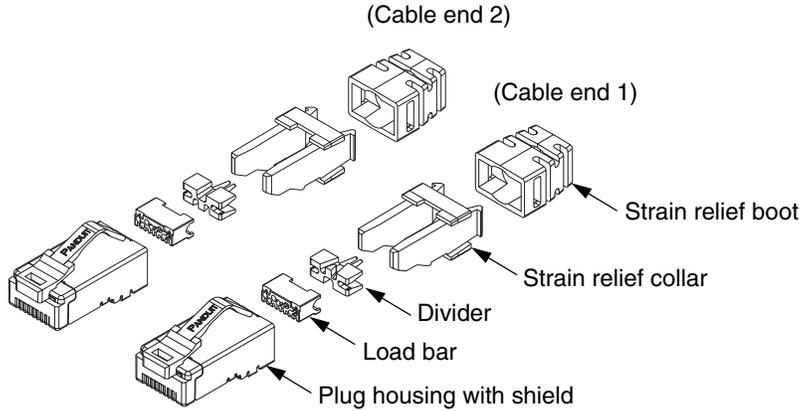


Pin #	8	7	6	5	4	3	2	1
T568A	BRN	BRN/WHT	ORG	BLU/WHT	BLU	ORG/WHT	GRN	GRN/WHT

Specifications

- Cable jacket diameter maximum 0.300 in (7.6mm).
- Solid or stranded conductor maximum insulated diameter 0.047 in (1.2mm).
- Panduit recommends T568A wiring scheme for use with cable constructed with the brown pair opposing the green pair.
- For use with F/UTP, U/FTP and S/FTP type cables, which meet the dimensional requirements. Cable must have drain wire or braid.


Load Bar

Conductor holes and contact slots


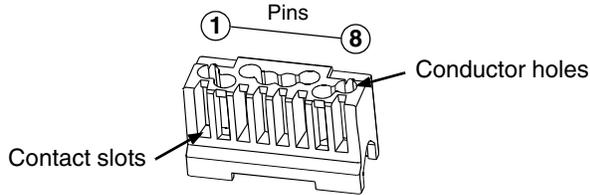


Divider

Conductor slots and "V" channel

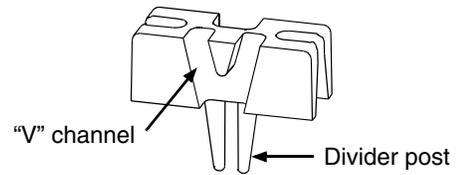


- 1** Thread on boot and collar first!
(Cable ends 1 & 2)

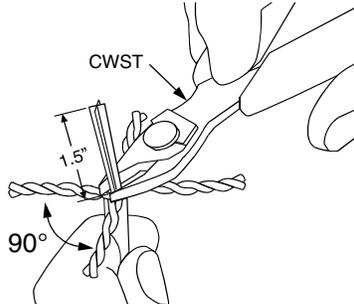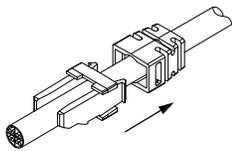


- Thread boot and collar onto cable.
- Remove 1.5" of the outer jacket from the cable end using wire stripping tool (CWST).
- Cut foil flush with cable jacket end. If cable is braided, form into a drain wire. Bend the drain wire back so it is against the cable jacket.
- Fan twisted pairs into respective quadrants. The brown pair should be opposite the green pair.
- When a cable spline (X-shaped filler) is present, cut spline flush to fanned pairs using wire snipping tool (CWST).

- 2**

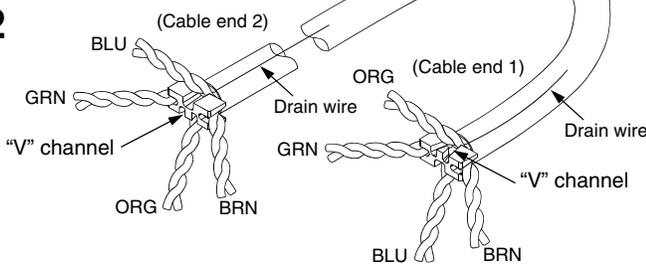

- The "V" channel should be aligned with the orange pair.
- Insert divider posts into the cable. If the cable has an internal spline, insert divider posts into the brown and green quadrants of the spline.

- 3**

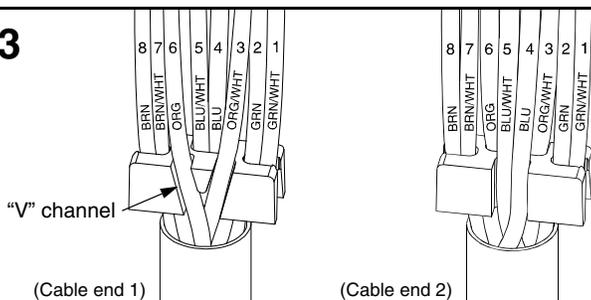

- Arrange conductors to T568A wiring scheme while minimizing untwist.
- Seat conductors into proper divider slots while holding divider flush with cable jacket.

4

Pin #	8	7	6	5	4	3	2	1
T568A	BRN	BRN/WHT	ORG	BLU/WHT	BLU	ORG/WHT	GRN	GRN/WHT

(Cable end 1)

- Straighten and align untwisted conductors using a circular motion while holding conductors in respective divider slots.
- Maintain grip of conductors in T568A wiring scheme.
- Trim conductors on an angle approximately 1.00" from divider leading edge.

5

(Cable end 2)

(Cable end 1)

Verify load bar orientation

Pins 1 8

Pins 1 8

- Orient load bar with contact slots facing downward.

6

7

(Cable end 1)

- Guide conductors into load bar holes while holding conductors in the divider.
- Slide load bar towards divider until flush.
- Ensure the divider/load bar is centered and perpendicular to the cable axis.
- Trim conductors flush with load bar face.

8

(Cable end 2)

Drain wire

Collar bars

Strain collar guides

Collar latches

Collar locking tabs

Boot position when using CSPT

(Cable end 1)

Pins 1 8

Pins 1 8

- Hold the load bar and divider stationary while sliding the strain relief collar forward until there is no gap between the collar and divider.
- Ensure the drain wire is routed through the strain collar guides.
- Confirm the cable jacket extends beyond the collar bars.
- Align pin #1 of cable sub-assembly (cable, load bar, divider, and strain relief collar) with pin #1 of plug housing.

9

Plug housing

10

MPT5-8AS

- Grip the strain relief collar and insert cable sub-assembly into the plug housing. (Fig. 9)
- Push sub-assembly into housing until collar locking tabs engage the plug housing pocket. Although not required, TX6 PLUS Plug Assembly Tool (CSPT) is available to facilitate this step.
- Use tool MPT5-8AS to complete plug termination. (Fig. 10)
- Trim or press excess drain wire between the collar latches.
- Push up boot and engage with collar latches.
- Visually check plug. Assembly is complete.

For Instructions in Local Languages and Technical Support:

www.panduit.com/resources/install_maintain.asp

PANDUIT

www.panduit.com

E-mail: techsupport@panduit.com

Phone: 866-405-6654