
# Smart Sensors (Laser Type) ZX Series (ZX-L-N)



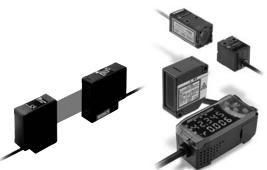

For the most recent information on models that have been certified for safety standards, refer to your OMRON website.

# **Ordering Information**

## Sensors

### Sensor Heads (Reflective)

Optical system	Beam shape	Sensing distance	Resolution*1	Model
Diffuse reflective	Spot beam	40±10 mm	2 μm	ZX-LD40
		100±40 mm	16 μm	ZX-LD100
		300±200 mm	300 μm	ZX-LD300
	Line beam	40±10 mm	2 μm	ZX-LD40L
		100±40 mm	16 μm	ZX-LD100L
		300±200 mm	300 μm	ZX-LD300L
Regular reflective	Spot beam	30±2 mm	0.25 μm	ZX-LD30V
	Line beam			ZX-LD30VL

\*1. For an average count of 4,096.

### Sensor Heads (Through-beam)

Optical system	Measuring width	Sensing distance	Resolution*1	Model *2
Through-beam	1-mm dia.	0 to 500 mm 4 μm		ZX-LT001
	1 to 2.5-mm dia.	500 to 2000 mm		
	5 mm	0 to 500 mm	4 μm	ZX-LT005
	10 mm			ZX-LT010
	30 mm		12 μm	ZX-LT030 0.5M

\*1. For an average count of 64.

\*2. The cable length for all models is 0.5 m.

### Amplifier Units

Appearance	Power supply	Output type	Model
51.	DC	NPN	ZX-LDA11-N 2M
A second se		PNP	ZX-LDA41-N 2M

Note: Compatible connection with the Sensor Head.

### Accessories (Order Separately) Calculating Unit

Appearance	Model
	ZX-CAL2

### **Side-view Attachments**

Appearance	Applicable Sensor Head	Model	Quantity
	ZX-LT1001/ LT005	ZX-XF12	1
	ZX-LT010	ZX-XF22	

### Logging Tool for Personal Computers

Appearance	Name	Model
9	Communications Interface Unit (RS-232C)	ZX-SF11
0	Smart Monitor *3 (Logging Software + Function Setting Software)	ZX-SW11EV3 *1

### **Setup Tool for Personal Computer**

	Name	Model
<b>9</b> <sup>+</sup>	Communications Interface Unit (RS-232C) + Smart Monitor Basic *2 *3 (Function Setting Software)	ZX-SFW11EV3 *1

\*1. The ZX-SFW11EV3 or ZX-SW11EV3 is required to use the Smart Monitor with the ZX-LDA11-N/41-N. Earlier versions cannot be used.

\*2. The Smart Monitor Basic does not have a logging function. Other than the logging function, the Smart Monitor Basic supports the same functions as the Smart Monitor.

\*3. It is prohibited to copy, to reproduce, and to distribute a part of or whole part of this document without the permission of OMRON Corporation.

# Cables with Connectors on Both Ends (for Extension) \*1

Cable length	Model	Quantity
1 m	ZX-XC1A 1M	1
4 m	ZX-XC4A 4M	
8 m	ZX-XC8A 8M	
9 m *2	ZX-XC9A 9M	
	ZX-XC9A 9M	nadal numbers are 7

\*1. Robot cable models are also available. The model numbers are ZX-XC R.
\*2. For use only with Reflective Sensors.

### **Bank Unit**

Appearance	Model
1242345	ZX-SB11

# **Specifications**

### Sensor Heads (Reflective)

Item Model	ZX-LD40	ZX-LD100	ZX-LD300	ZX-LD30V	ZX-LD40L	ZX-LD100L	ZX-LD300L	ZX-LD30VL
Optical system	Diffuse reflective Regular re- flective				Diffuse reflective			Regular reflec- tive
Light source (wave length)	Red light emi	tting semicond	uctor laser witl	h a wavelength	of 650 nm and	d an output of	1 mW max.	
Laser class	Class 1 (EN/I Class II (FDA	EC, JIS, GB/T .)	)					
Measurement point	40 mm	100 mm	300 mm	30 mm	40 mm	100 mm	300 mm	30 mm
Measurement range	±10 mm	±40 mm	±200 mm	±2 mm	±10 mm	±40 mm	±200 mm	±2 mm
Beam shape	Spot				Line			
Beam size*1	50-μm dia.	100-µm dia.	300-µm dia.	75-µm dia.	75 μm x 2 mm	150 μm x 2 mm	450 μm x 2 mm	100 μm x 1.8 mm
Resolution*2	2 μm	16 µm	300 µm	0.25 μm	2 µm	16 µm	300 µm	0.25 μm
Linearity*3	±0.2% FS (entire range)	±0.2% FS (80 to 120 mm)	±2% FS (200 to 400 mm)	±0.2% FS (entire range)	±0.2% FS (32 to 48 mm)	±0.2% FS (80 to 120 mm)	±2% FS (200 to 400 mm)	±0.2% FS (entire range)
Temperature characteristic*4	±0.03% FS/°0	±0.03% FS/°C (Except for ZX-LD300 and ZX-LD300L, which are ±0.1% FS/°C.)						
Ambient illumination	Incandescent	: lamp: 3,000 l>	max. (on ligh	t receiving side	e)			
Ambient temperature	Operating: 0	to 50°C, Stora	ge: –15 to 60°0	C (with no icing	or condensati	on)		
Ambient humidity	Operating an	d storage: 35%	to 85% (with	no condensatio	on)			
Insulation resistance	20 M $\Omega$ min. a	t 500 VDC						
Dielectric strength	1,000 VAC, 5	0/60 Hz for 1 r	nin					
Vibration resistance (destruction)	10 to 150 Hz,	10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions						
Shock resistance (destruction)	300 m/s <sup>2</sup> 3 tir	nes each in six	directions (up	/down, left/righ	t, forward/bacl	kward)		
Degree of protection	IEC60529, IP	IEC60529, IP50 IEC60529, IP50 IEC60529, IP50 IEC60529, IP40						
Connection method	Connector re	lay (standard c	able length: 50	00 mm)				•
Weight (packed state)	Approx. 150 (							Approx. 250 g
Materials	Case: PBT (polybutylene terephthalate), Cover: Aluminum, Lens: Glass Glass				Case: PBT (p Cover: Alumi	oolybutylene te num, Lens: Gla	rephthalate), ass	Case and cov- er: Aluminum, Lens: Glass
Accessories	Instruction sh	nstruction sheet, Laser warning label (English)						

\*1. Beam size: The beam size is defined by 1/e<sup>2</sup> (13.5%) of the strength of the beam at the beam center (measured value). Incorrect detection may occur if there is light leakage outside the defined spot and the material around the sensing object is more reflective than the sensing object.

\*2. Resolution: The resolution is the deviation (±3σ) in the linear output when connected to the ZX-LDA Amplifier Unit. (The resolution is measured with the standard reference object (white ceramic), at the measurement point with the ZX-LDA set for an average count of 4,096 per period.) The resolution is given at the repeat accuracy for a stationary workpiece, and is not an indication of the distance accuracy. The resolution may be adversely affected under strong electromagnetic fields.

\*3. Linearity: The linearity is given as the error in an ideal straight line displacement output when measuring the standard reference object. The linearity and measurement values vary with the object being measured.

\*4. Temperature characteristic: The temperature characteristic is measured at the measurement point with the Sensor and reference object (OMRON's standard reference object) secured with an aluminum jig.

Note: Highly reflective objects can result in incorrect detection by causing out-of-range measurements.

## Sensor Heads (Through-beam)

ltem	Model	ZX	-LT001	ZX-LT005	ZX-LT010	ZX-LT030
Optical sys	otical system Through-beam		•	•		
Light sourd (wave leng					50 nm	
Maximum output 0.2 mW max. 0.35 mW max.			0.35 mW max.		0.2 mW max.	
Laser class	class Class 1 (EN/IEC, JIS, GB/T) Class II (FDA)					
Measureme	ent width	1-mm dia.	1- to 2.5-mm dia.	5 mm	10 mm	30 mm
Measureme distance	ent	0 to 500 mm	500 to 2,000 mm	0 to 500 mm		·
Minimum s object	ensing	8-μm dia. (opaque)	8- to 50-μm dia. (opaque)	0.05-mm dia. (opaque)	0.1-mm dia. (opaque)	0.3-mm dia. (opaque)
Resolution	lution*1 4 μm *2 4 μm *3				12 μm *4	
Temperatu characteris		±0.2% FS/°C				±0.3% FS/°C
Ambient ill	umination	Incandescent lamp: 10,000 l× max. (on light-receiving side)				
Ambient te	mperature	Operating: 0 to 8	50°C, Storage: –25 t	o 70°C (with no icing or co	ondensation)	
Ambient hu	umidity		to 85% (with no con	densation)		
Degree of <b>p</b>	protection	IEC60529, IP40				
Connectior	n method	Connector relay	(standard cable leng	gth: 500 mm)		
Weight (pa	cked state)	Approx. 220 g				Approx. 450 g
Cable leng	th	Extendable up to	o 10 m with special e	extension cable.		
Materials	Case	Polyetherimide				Zinc die-cast
	Cover	Polycarbonate				
	Front filter	Glass				
Tightening	torque	0.3 N⋅m max.				
Accessorie	s	Instruction shee	t, Sensor Head-Amp	lifier Connection Cable		
		Optical axis adjustment seal				Mounting Bracket

\*1. This value is obtained by converting the deviation  $(\pm 3\sigma)$  in the linear output that results when the sensor head is connected to the amplifier unit, into the measurement width.

\*2. For an average count of 64. The value is 5  $\mu$ m for an average count of 32.

This is the value that results when a minimum sensing object blocks the light near the center of the 1-mm measurement width.

\*3. For an average count of 64. The value is 5  $\mu$ m for an average count of 32.

\*4. For an average count of 64. The value is 15  $\mu m$  for an average count of 32.

# Amplifier Units

Item Model	ZX-LDA11-N	ZX-LDA41-N		
Measurement period*1	150 μs			
Possible average count settings	1, 2, 4, 8, 16, 32, 64, 128, 256, 512, 1,024, 2,048, or	r 4,096		
Temperature characteristic	When connected to a Reflective Sensor Head: 0.01% FS/°C, When connected to a Through-beam Sensor Head: 0.1% FS/°C			
Linear output*2	Current output: 4 to 20 mA/FS, Max. load resistance			
	Voltage output: $\pm$ 4 V ( $\pm$ 5 V, 1 to 5 V *3), Output impe	edance: 100 Ω		
Judgement outputs (3 outputs: HIGH/PASS/LOW)*1	NPN open-collector outputs, 30 VDC, 50 mA max. Residual voltage: 1.2 V max.	PNP open-collector outputs, 30 VDC, 50 mA max. Residual voltage: 2 V max.		
Laser OFF input, zero reset input, timing input, reset input	ON: Short-circuited with 0-V terminal or 1.5 V or less OFF: Open (leakage current: 0.1 mA max.)	within 1.5 V OFF: Open (leakage current: 0.1 mA max.)		
Functions	Measurement value display, present value/set value/light level/resolution display, scaling, display reversed display OFF mode, ECO mode, number of display digit changes, sample hold, peak hold, bottom hold, peak-to-peak hold, self-peak hold, self-bottom hold, average hold, delay hold, intensity mode, zero reser initial reset, ON-delay timer, OFF-delay timer, one-shot timer, deviation, previous value comparison, sensitivity adjustment, keep/clamp switch, direct threshold value setting, position teaching, 2-point teaching, automatic teaching, hysteresis width setting, timing inputs, reset input, monitor focus, linear output compensation, (A-B) calculations*4, (A+B) calculations*4, mutual interference*4, laser deterioration detection, zero reset memory, zero reset display, key lock			
Indications	Operation indicators: High (orange), pass (green), low (yellow), 7-segment main display (red), 7-segment subdisplay (yellow), laser ON (green), zero reset (green), enable (green)			
Power supply voltage	12 to 24 VDC ±10%, Ripple (p-p): 10% max.			
Current consumption	140 mA max. with power supply voltage of 24 VDC (with Sensor connected)			
Ambient temperature	Operating and storage: 0 to 50°C (with no icing or condensation)			
Ambient humidity	Operating and storage: 35% to 85% (with no conder	nsation)		
Insulation resistance	20 MΩ min. at 500 VDC			
Dielectric strength	1,000 VAC, 50/60 Hz for 1 min			
Vibration resistance (destruction)	10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions			
Shock resistance (destruction)	300 m/s <sup>2</sup> 3 times each in six directions (up/down, left/right, forward/backward)			
Connection method	Prewired (standard cable length: 2 m)			
Weight (packed state)	Approx. 350 g			
Materials	Case: PBT (polybutylene terephthalate), Cover: Poly	/carbonate		
Accessories	Instruction sheet			

\*1. The response time for the first linear output or judgment output is calculated as follows (with fixed sensitivity): Measurement period × (Average count setting + 1). The response time for the second and later outputs is the measurement period specified in the table.

\*2. The output can be switched between a current output and voltage output using a switch on the bottom of the Amplifier Unit.

\*3. Setting is possible via the monitor focus function.

\*4. A Calculating Unit (ZX-CAL2) is required.

# ■Calculating Unit

Item	ZX-CAL2	
Applicable Amplifier Units	ZX-LDA11-N/41-N/ZX-EDA11/41/ZX-TDA11/41	
Current consumption	12 mA max. (supplied from the Smart Sensor Amplifier Unit)	
Ambient temperature	Operating: 0 to 50°C, Storage: –15 to 60°C (with no icing or condensation)	
Ambient humidity	Operating and storage: 35% to 85% (with no condensation)	
Connection method	Connector	
Dielectric strength	1,000 VAC, 50/60 Hz for 1 min	
Insulation resistance	100 MΩ (at 500 VDC)	
Vibration resistance (destructive)	10 to 150 Hz, 0.7-mm double amplitude 80 min each in X, Y, and Z directions	
Shock resistance (destructive)	300 m/s <sup>2</sup> 3 times each in six directions (up/down, left/right, forward/backward)	
Materials	Display: Acrylic, Case: ABS resin	
Weight (packed state)	Approx. 50 g	

# **ZX-series Communications Interface Unit**

Item		ZX-SF11	
Current consumptio	n	60 mA max. (supplied by the Amplifier Unit)	
Applicable Amplifier	Units	ZX Series	
Applicable Amplifier Unit versions		ZX-LDA 1-N Ver. 2.100 or higher ZX-EDA 1 Ver. 1.100 or higher ZX-TDA 1 Ver. 1.000 or higher	
Max. No. of Amplifie	r Units	5 (max. 2 with calculating unit)	
Communications functions port		RS-232C port (9-pin D-Sub Connector)	
Communications protocol	CompoWay/F*		
	Baud rate	38,400 bps	
	Data configuration	Data bits: 8, Parity: none, Start bits: 1, Stop bits: 1, Flow control: none	
Indicators		Power supply: green, Sensor communications: green, Sensor communications error: red, Exter- nal terminal communications: green, External terminal communications error: red	
Protective circuits		Reverse polarity protection	
Ambient temperature	9	Operating: 0 to 50°C, storage: -15 to 60°C (with no icing or condensation)	
Ambient humidity		Operating and storage: 35% to 85% (with no condensation)	
Insulation resistance	)	20 MΩ min. (at 500 VDC)	
Dielectric strength		1,000 VAC, 50/60 Hz for 1 min, Leakage current: 10 mA max.	
Materials		Case: PBT (polybutylene terephthalate), Cover: Polycarbonate	
Accessories		Instruction sheet, 2 clamps	

\* Contact your OMRON representative for CompoWay/F communications specifications.


# **Engineering Data (Reference Value)**


### Angle Characteristic (Reflective Sensors)

The angle characteristic plots the relation between the inclination of the measurement object and the error in the linear output at the measurement point.


Note: SUS304 = Stainless steel SUS304

#### ●ZX-LD40

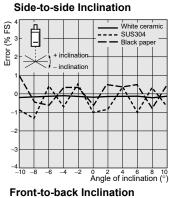


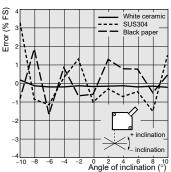


#### • ZX-LD40L Side-to-side Inclination

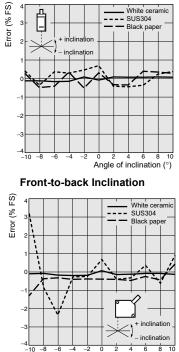


Angle of inclination (°)

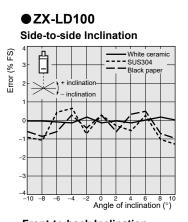


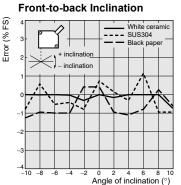


# ZX-LD100L Side-to-side Inclination

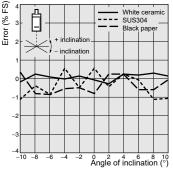


#### Front-to-back Inclination

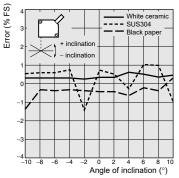

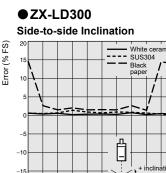



Front-to-back Inclination

-20 \_10 Angle of inclination (°)

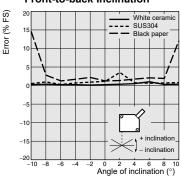


#### • ZX-LD300L Side-to-side Inclination

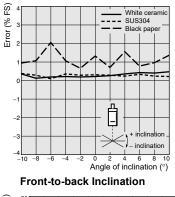


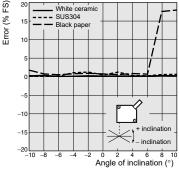


ZX Series (ZX-L-N) Smart Sensors (Laser Type)


#### • ZX-LD30V Side-to-side Inclination

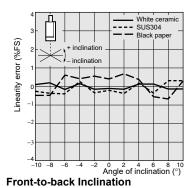

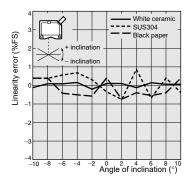


#### • ZX-LD30VL Side-to-side Inclination

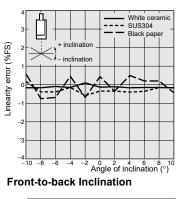


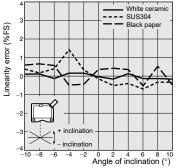

### Linearity Characteristic for Different Materials (Reflective Sensors)


### •ZX-LD40

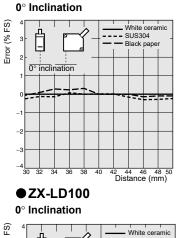

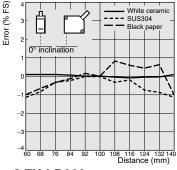


• ZX-LD300




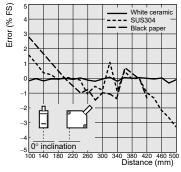




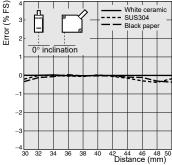


-10° Inclination Front-to-back

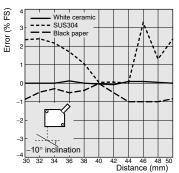


-10° Inclination Front-to-back

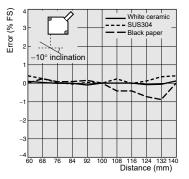


-10° Inclination Front-to-back

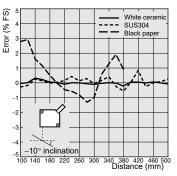




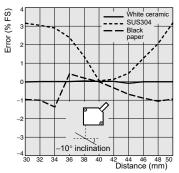


#### 10° Inclination

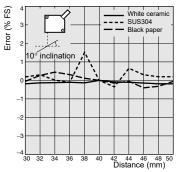


10° Inclination

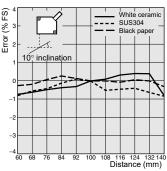


10° Inclination

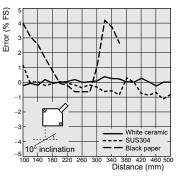


10° Inclination

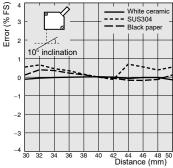




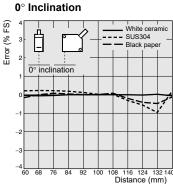


●ZX-LD300L

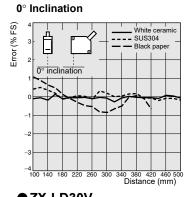


ZX-LD30V 0° Inclination

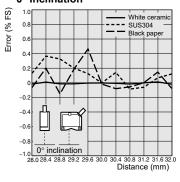


●ZX-LD30VL

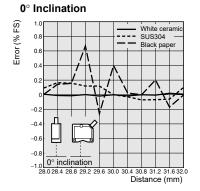


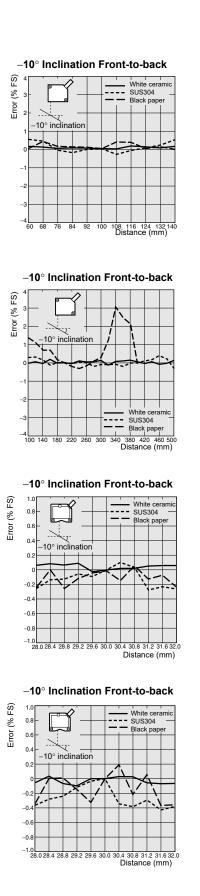


#### 10° Inclination

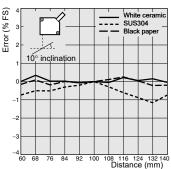


#### 10° Inclination

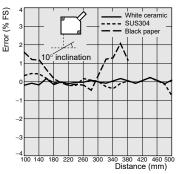

#### 10° Inclination

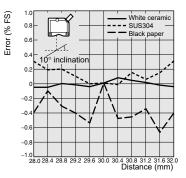

#### 10° Inclination

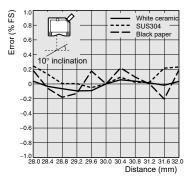


### **ZX Series (ZX-L-N)** Smart Sensors (Laser Type)

10

### Beam Size (Reflective Sensors)

### • Spot Beams

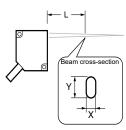

### ZX-LD40

L	30 mm	40 mm	50 mm
Х	240 μm	40.0 μm	250 μm
Y	350 μm	30.0 μm	370 μm


### ZX-LD100

L	60 mm	100 mm	140 mm
Х	390 μm	100 µm	430 µm
Y	620 μm	65.0 μm	650 μm

### ZX-LD300

L	100 mm	300 mm	500 mm
Х	1,050 μm	180 μm	1,100 μm
Y	450 μm	300 µm	850 μm

### ● Line Beams

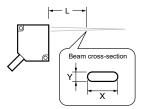

### ZX-LD40L

L	30 mm	40 mm	50 mm
Х	2,000 μm	2,000 μm	2,000 μm
Y	240 μm	50.0 μm	250 μm


#### ZX-LD100L

L	60 mm	100 mm	140 mm
Х	2,000 μm	2,000 μm	2,000 μm
Y	410 µm	100 µm	430 µm

### ZX-LD300L

L	100 mm	300 mm	500 mm
Х	2,000 μm	2,000 μm	2,500 μm
Y	750 μm	300 µm	650 μm


### • Spot Beams

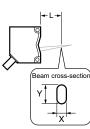

### ZX-LD30V

L	28 mm	30 mm	32 mm
Х	60.0 μm	30.0 µm	120 µm
Y	50.0 μm	40.0 µm	90.0 μm

### Line Beams

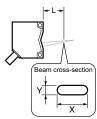


#### ZX-LD30VL


L	28 mm	30 mm	32 mm
Х	1,800 μm	1,800 μm	1,800 µm
Y	90.0 µm	60.0 μm	110 µm

### Sensing Object Characteristics (Through-beam Sensors)

### ●ZX-LT001

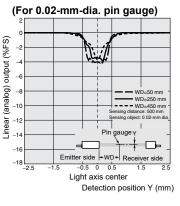



### ●ZX-LT010

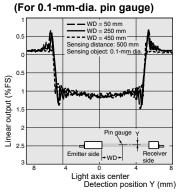


### **Linearity Characteristics**

### • ZX-LT005

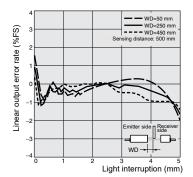


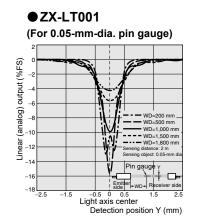

# • ZX-LT005 (For 0.05-mm-dia. pin gauge)

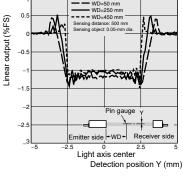




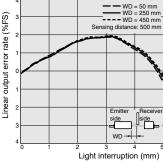


# Linear Output vs. Sensing Distance

The output can be switched between a current output and a voltage output using a switch on the Amplifier Unit.


#### ZX-LD40/LD40L

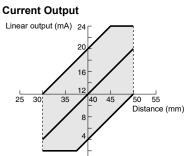


### ZX-LD100/LD100L

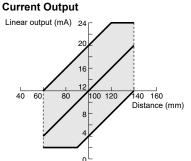


#### ZX-LD300/LD300L Current Output

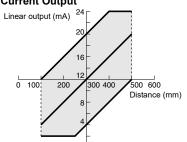

#### ZX-LD30V/LD30VL Current Output Measurement range (4 mm)

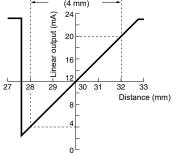

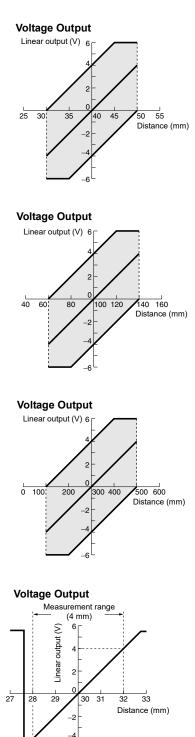


-6

**ZX Series (ZX-L-N)** Smart Sensors (Laser Type)


# I/O Circuit Diagrams

#### NPN Amplifier Unit: ZX-LDA11-N

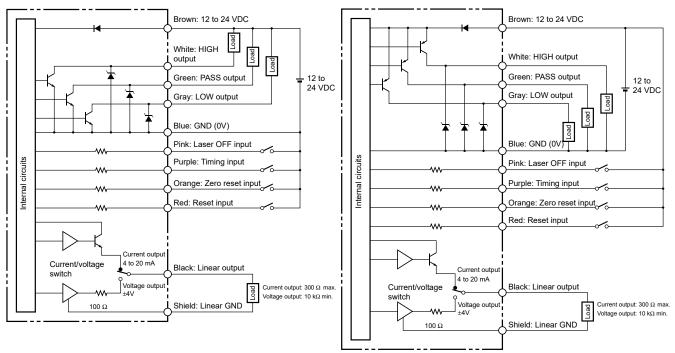

**PNP Amplifier Unit: ZX-LDA41-N** 


# **Connections: Amplifier Unit**

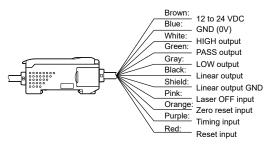

- Note 1. Use a separate stabilized power supply for the Amplifier Unit, particularly when high resolution is required.
  - 2. Wire the Unit correctly. Incorrect wiring may result in damage to the Unit. (Do not allow wiring, particularly the linear output, to come into contact with other lines.)
  - 3. Use the 0-V line (blue) for the power supply and use the shield wire (linear output ground) together with the linear output (black line) for linear output. Each of these grounds must be used for the designed purpose. When not using the linear output, connect the linear ground (shield) to the 0-V ground.

### 14 **ZX Series (ZX-L-N)** Smart Sensors (Laser Type)

# **Part Names**

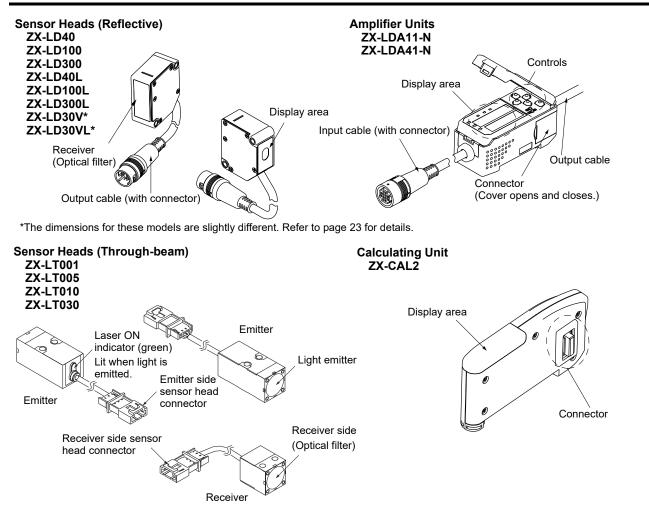

### Design Precautions

### **Ratings and Performance**

- Conform to the specified ratings and performance. Refer to *Specifications* for details.
  - 1. Do not impose voltage exceeding the rated voltage, otherwise the Sensor may be damaged.
  - 2. When supplying power to the Sensor, make sure that the polarity of the power is correct, otherwise, the Sensor may be damaged. Do not connect to an AC power supply.
  - 3. Do not short-circuit the load for the open collector output, otherwise the Sensor may be damaged.
- Do not disconnect the connector connecting the Sensor Head and the controller while power is being supplied, otherwise the Sensor may be damaged.
- Allow a warm-up period of approximately 10 minutes after turning ON the power supply.
- Objects of certain materials or shapes may not be detectable, or the detection accuracy may not be sufficiently high. These include materials that are transparent or have extremely low reflectivity, and objects that are smaller than the Sensor's spot diameter or have extreme curvature or inclination.

### **Power Supply and Wiring**

- Prior to turning ON the power supply after wiring is completed, check to make sure that the power supply is correct, that there are no mistaken connections, e.g., connections that would short-circuit the load, and that the load current is appropriate. Incorrect wiring may result in damage to the Sensor or Unit.
- The total length of the Sensor cable or Amplifier cable must be 10 m or less. Use an ZX-XC\_A Extension Cable (order separately) if required to extend the cable from the Sensor. Use a shielded cable to extend the Amplifier cable. The shielded cable must be the same as that of the Amplifier cable.
- Do not lay a power supply cable for the ZX together with high-voltage lines or power lines to prevent interference, damage, and malfunction.
- When using a commercially available switching regulator, ground the FG (frame ground) terminal.
- If the power supply line is subject to surges, connect a surge absorber that meets the conditions of the usage environment.
- When using a Calculating Unit, connect the corresponding linear ground of the Amplifier Unit.

### **Compatibility**

• All Sensor Heads and Amplifier Units are compatible. Different Sensor Heads may be purchased at a later date and used with existing Amplifier Units.

### Mutual Interference

 Two Sensor Heads can be used together, without danger of mutual interference, by connecting the ZX-CAL 2 Calculating Unit between two Amplifier Units.

### **Maintenance**

- Always turn OFF the power supply before adjusting or removing the Sensor Head.
- Cleaning

Do not use thinners, benzine, acetone, or kerosene for cleaning. If dust or oil adheres to the filter on the front of the Sensor Head, use the following procedure to clean.

- 1. Use a blower brush (used to clean camera lenses) to blow large dust particles from the surface. Do not blow the dust away with your mouth.
- 2. Use a soft cloth (for lenses) with a small amount of alcohol to remove the remaining dust. Do not use a scrubbing action when cleaning because scratches on the filter could result in Sensor inaccuracy.

### ■Other Precautions

### **Environment**

- Do not use the Sensor in strong electromagnetic fields or in an environment where the operation of the Sensor is subject to the reflection of intense light (such as other laser beams or electric arc-welding machines.)
- 2. Do not operate the Sensor in the following locations:
- Locations subject to strong vibration.
  - Locations subject to direct sunlight or near heating equipment.
  - · Locations subject to high humidity.
  - Locations where the Sensor would accumulate dust, dirt, metallic powder, etc.
  - · Locations subject to corrosive or flammable gases.
  - Locations subject to exposure to organic solvents, water, oil, etc.
  - Locations subject to strong electromagnetic or electrical fields.
  - · Locations subject to rapid changes in temperature.
  - · Locations subject to freezing.

# Laser Safety

The ZX-LD-Series Sensor Heads are FDA Class II and EN Class 1 Laser Products. The ZX-LT-Series Sensor Heads are FDA Class II and EN Class 1 Laser Products. The ZX Series is meant to be built into final system equipment. Pay special attention to the following precautions for the safe use of the product:

- Note: Europe: Class 1 of IEC60825-1: 2014/EN60825-1: 2014+A11: 2021 U.S.A.: Class II of FDA (21 CFR 1040.10 and 1040.11) Japan: Class 1 of JIS C6802: 2014
  - China: Class 1 of GB/T 7247.1-2024
  - 1. Use this product as specified in this instruction manual. Otherwise, you may be exposed to hazardous laser radiation.
  - 2. The ZX-series Smart Sensors radiate laser beams in the visible light range. Do not expose your eyes directly to the laser radiation. Ensure that the laser beam path is terminated during use. If a mirror or shiny surface is positioned in the laser beam path, ensure that the reflected beam path is also terminated. If the Unit must be used without terminating the laser beam path, position the laser beam path so that it is not at eye level.
  - 3. To avoid exposure to hazardous laser radiation, do not displace nor remove the protective housing during operation, maintenance, and any other servicing.
  - 4. The user should return the product to OMRON for all repair and servicing.
  - 5. As for other countries, observe the regulations and standards specified by each country.



### **Requirements from Regulations and Standards**

# EN60825-1 "Safety of Laser Products, Equipment Classification, Requirements and User's Guide"

#### Summary of Manufacturer's Requirements

Requirements;			Classification		
Sub-clause	Class 1	Class 2	Class 3A	Class 3B*	Class 4
Description of hazard class	Safe under reason- ably foreseeable con- ditions	Low power; eye pro- tection normally af- forded by aversion responses	Same as Class 2. Di- rect intrabeam view- ing with optical aids may be hazardous	Direct intrabeam view- ing may be hazardous	High power; diffused reflection may be haz- ardous
Protective housing	Required for each lase	er product; limits access	necessary for perform	ance of functions of the p	products
Safety interlock in pro- tective housing	Designed to prevent re assigned	Designed to prevent removal of the panel until accessible emission values are below the AEL (see note 2) for the class ssigned			
Remote control	Not required	Not required		Permits easy addition o ser installation	f external interlock in la-
Key control	Not required	Not required			key is removed
Emission warning de- vice	Not required			Gives audible or visible warning when laser is switched on or if capacitor bank of pulsed laser is being charged	
Attenuator	Not required	Not required		Gives means beside ON/OFF switch to tempo- rarily block beam	
Location controls				hat there is no danger of exposure to AEL above adjustments are made.	
Viewing optics	Emission from all view	ing systems must be be	elow Class 1 AEL's as a	pplicable	
Scanning	Scan failure shall not o	ause product to excee	d its classification		
Class label	Required wording	Figures A and B and s	pecified wording		
Aperture label	Not required			Specified wording requ	ired
Service entry label	Required as appropria	te to the class of acces	sible radiation		
Override interlock label	Required under certain	n conditions as appropr	iate to the class of lase	used	
User information	Operation manuals mu	st contain instructions	for safe use		
Purchasing and service information	Promotion brochures r	nust reproduce classific	cation labels; service ma	anuals must contain safe	ety information
Medical products	Special calibration inst	ructions required		Special calibration instr measurement and targe	
Fibre optic	Cable service connect above Class 1	ions require tool to disc	connect if disconnection	breaks protective housir	ng and permits access

\*With respect to the requirements of remote interlock connector, key control, emission warning and attenuator, Class 3B laser products not exceeding five times the AEL of Class 2 in the wavelength range of 400 nm to 700 nm are to be treated as Class 3A laser products.



Note 1. This table is intended to provide a convenient summary of requirements. See text of this standard for complete requirements.

2. AEL: Accessible Emission Limit

The maximum accessible emission level permitted within a particular class. For your reference, see ANSI Z136.1-1993, Section 2.

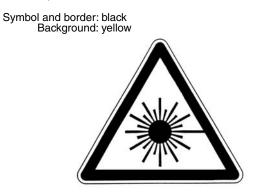


Figure A Warning label - Hazard symbol

Legend and border: black Background: yellow

クラス	11-	ザ製品
CLASS 1	LASER	PRODUCT

Figure B Explanatory label

### ● FDA (Compliance Guide for Laser Products, 1985, according to 21 CFR1040.10)

Requirements	Class (see note 1)					
	I	lla	II	Illa	IIIb	IV
Performance (all laser proc	ducts)		•	•	•	
Protective housing	R (see note 2)					
Safety interlock	R (see notes 3, 4)					
Location of controls	N/A	R	R		R	R
Viewing optics	R	R	R	R	R	R
Scanning safeguard	R	R	R	R	R	R
Performance (laser system	is)					
Remote control connector	N/A	N/A	N/A	N/A	R	R
Key control	N/A	N/A	N/A	N/A	R	R
Emission indicator	N/A	N/A	R	R	R (see note 10)	R (see note 10)
Beam attenuator	N/A	N/A	R	R	R	R
Reset	N/A	N/A	N/A	N/A	N/A	R (see note 13)
Performance (specific purp	ose products)					
Medical	S	S	S	S (see note 8)	S (see note 8)	S (see note 8)
Surveying, leveling, align- ment	S	S	S	S	NP	NP
Demonstration	S	S	S	S	S (see note 11)	S (see note 11)
Labeling (all laser products	5)		•	•	•	
Certification & identifica- tion	R	R	R	R	R	R
Protective housing	D (see note 5)					
Aperture	N/A	N/A	R	R	R	R
Class warning	N/A	R (see note 6)	R (see note 7)	R (see note 9)	R (see note 12)	R (see note 12)
Information (all laser produ	icts)		•	•	•	
User information	R	R	R	R	R	R
Product literature	N/A	R	R	R	R	R
Service information	R	R	R	R	R	R

Abbreviations:

R: Required.

N/A: Not applicable.

S: Requirements: Same as for other products of that Class.

Also see footnotes.

NP: Not permitted.

D: Depends on level of interior radiation.

Footnotes:

- 1. Based on highest level accessible during operation.
- 2. Required wherever & whenever human access to laser radiation above Class I limits is not needed for product to perform its function.
- 3. Required for protective housings opened during operation or maintenance, if human access thus gained is not always necessary when housing is open.
- 4. Interlock requirements vary according to Class of internal radiation.
- 5. Wording depends on level & wavelength of laser radiation within protective housing.
- 6. Warning statement label.
- 7. CAUTION logotype.
- 8. Requires means to measure level of laser radiation intended to irradiate the body.
- 9. CAUTION if 2.5 mW cm<sup>2</sup> or less, DANGER if greater than 2.5 mW cm<sup>2</sup>.
- 10. Delay required between indication & emission.
- 11. Variance required for Class IIb or iV demonstration laser products and light shows.
- 12. DANGER logotype.
- 13.Required after August 20, 1986.

### **Use Precautions**

### • EN60825-1

Requirements;	Classification					
Sub-clause	Class 1	Class 2	Class 3A	Class 3B*	Class 4	
Remote interlock	Not required		•	Connect to room or do	or circuits	
Key control	Not required			Remove key when not in use		
Beam attenuator	Not required			When in use prevents inadvertent exposure		
Emission indicator de- vice	Not required			Indicates laser is ener	gized	
Warning signs	Not required			Follow precautions on warning signs		
Beam path	Not required	Terminate beam at end of useful length				
Specular reflection	No requirements			Prevent unintentional	reflections	
Eye protection	No requirements		Required if engineerin and MPE exceeded	g and administrative procedures not practicable		
Protective clothing	No requirements		•	Sometimes required	Specific requirements	
Training	No requirements Required for all ope			tor and maintenance per	sonnel	

\*With respect to the requirements of remote interlock connector, key control, beam attenuator, and emission indicator, Class 3B laser products not exceeding five times the AEL of Class 2 in the wavelength range of 400 nm to 700 nm are to be treated as Class 3A laser products.

Note: This table is intended to provide a convenient summary of requirements. See text of this standard for complete precautions.

#### ANSI Z136.1:1993 "American National Standard for the Safe Use of Lasers" Control Measures for the Four Laser Classes

Control measures	Classification					
Engineering Controls	1	2a	2	3a	3b	4
Protective Housing (4.3.1)	Х	Х	Х	х	Х	Х
Without Protective Housing (4.3.1.1)	LSO (see note 2) shall establish Alternate Controls					
Interlocks on Protective Housing (4.3.2)	*	☆	*	*	Х	Х
Service Access Panel (4.3.3)	*	☆	*	*	Х	Х
Key Control (4.3.4)					•	Х
Viewing Portals (4.3.5.1)			MPE	MPE	MPE	MPE
Collecting Optics (4.3.5.2)	MPE	MPE	MPE	MPE	MPE	MPE
Totally Open Beam Path (4.3.6.1)					X NHZ	X NHZ
Limited Open Beam Path (4.3.6.2)					X NHZ	X NHZ
Enclosed Beam Path (4.3.6.3)	None is requ	ired if 4.3.1 and	d 4.3.2 fulfilled	1		
Remote Interlock Connector (4.3.7)					•	Х
Beam Stop or Attenuator (4.3.8)					•	Х
Activation Warning Systems (4.3.9)					•	Х
Emission Delay (4.3.9.1)						Х
Indoor Laser Controlled Area (4.3.10)					X NHZ	X NHZ
Class 3b Laser Controlled Area (4.3.10.1)					х	
Class 4 Laser Controlled Area (4.3.10.2)						Х
Laser Outdoor Controls (4.3.11)					X NHZ	X NHZ
Laser in Navigable Airspace (4.3.11.2)				•	•	•
Temporary Laser Controlled Area (4.3.12)	* MPE	* MPE	* MPE	* MPE		
Remote Firing & Monitoring (4.3.13)						•
Labels (4.3.14 and 4.7)	Х	Х	Х	Х	Х	Х
Area Posting (4.3.15)				•	X NHZ	X NHZ
Administrative & Procedural Controls	1	2a	2	3a	3b	4
Standard Operating Procedures (4.4.1)					•	Х
Output Emission Limitations (4.4.2)				LSO Determi	nation	
Education and Training (4.4.3)			•	•	Х	Х
Authorized Personnel (4.4.4)					Х	Х
Alignment Procedures (4.4.5)			Х	Х	Х	Х

20 **ZX Series (ZX-L-N)** Smart Sensors (Laser Type)

Control measures	Classification						
Protective Equipment (4.4.6)					•	Х	
Spectator (4.4.7)					•	Х	
Service Personnel (4.4.8)	* MPE	* MPE	* MPE	* MPE	Х	x	
Demonstration with General Public (4.5.1)	MPE †		Х	Х	Х	Х	
Laser Optical Fiber Systems (4.5.2)	MPE	MPE	MPE	MPE	Х	Х	
Laser Robotic Installations (4.5.3)					X NHZ	X NHZ	
Eye Protection (4.6.2)					• MPE	X MPE	
Protective Windows (4.6.3)					X NHZ	X NHZ	
Protective Barriers and Curtains (4.6.4)					•	•	
Skin Protection (4.6.5)					X MPE	X MPE	
Other Protective Equipment (4.6.5)	Use may be required						
Warning Signs and Labels (4.7) (Design Requirements)			•	•	X NHZ	X NHZ	
Service and Repairs (4.8)	LSO Determination						
Modification of Laser Systems (4.9)	LSO Determination						

#### Note 1. LEGEND

- X: Shall
- Should •:
- No requirement ----:
- ★: Shall if enclosed Class 3b or Class 4
- MPE: Shall if MPE is exceeded
- NHZ: Nominal Hazard Zone analysis required **†**:
  - Applicable only to UV and IR Lasers (4.5.1.2)
- 2. LSO: Laser Safety Officer

An individual shall be designated the Laser Safety Officer with the authority and responsibility to monitor and enforce the control of laser hazards, and to effect the knowledgeable evaluation and control of laser hazards. For your reference, see ANSI Z136.1-1993, Section 1.3.

### Laser Product Classifications

#### • EN

Class	Description
Class 1	Lasers which are safe under reasonably foreseeable conditions of operation.
Class 2	Lasers emitting visible radiation in the wavelength range from 400 nm to 700 nm. Eye protection is normally afforded by aversion responses including the blink reflex.
Class 3A	Lasers which are safe for viewing with the unaided eye. For laser emitting in the wavelength range from 400 nm to 700 nm, protection is afforded by aversion responses including the blink reflex. For other wavelengths the hazard to the unaided eye is no greater than for Class 1. Direct intrabeam viewing of Class 3A lasers with optical aides (e.g., binoculars, tele-scopes, microscopes) may be hazardous.
Class 3B	Direct intrabeam viewing of these lasers is always hazardous. Viewing diffuse reflections is normally safe (see note).
Class 4	Lasers which are also capable of producing hazardous diffuse reflections. They may cause skin injuries and could also constitute a fire hazard. Their use requires extreme caution.


Note: Conditions for safe viewing of diffuse reflections for Class 3B visible lasers are: minimum viewing distance of 13 cm between screen and cornea and a maximum viewing time of 10 s. Other viewing conditions require a comparison of the diffuse reflection exposure with the MPE.

### **Comparison of Classifications between FDA and ANSI**

Class	FDA definition	ANSI description	
Class I/1	Limits applicable to devices that have emissions in the ultraviolet, visible, and infrared spectra, and limits below which biological hazards have not been established.	A Class 1 laser is considered to be incapable of pro- ducing damaging radiation levels during operation and maintenance and is, therefore, exempt from any con- trol measures or other forms of surveillance.	
Class IIa/2a	Limits applicable to products whose visible emission does not exceed Class I limits for emission durations of 1,000 seconds or less and are not intended for viewing.	Class 2 lasers are divided into two subclasses, 2 al 2a. A Class 2 laser emits in the visible portion of th spectrum (0.4 to $0.7 \mu$ m) and eye protection is norm	
Class II/2	Limits applicable to products that have emissions in the visible spectrum (400 to 710 nm) for emission durations in excess of 0.25 second, pro- viding that emissions for other durations and/or wavelengths do not ex- ceed the Class I limits. Class II products are considered hazardous for direct long-term ocular exposure.	ly afforded by the aversion response including the blink reflex.	
Class Illa/3a	Limits to products that have emissions in the visible spectrum and that have beams where the total collectable radiant power does not exceed 5 milliwatts.		
Class IIIb/3b	Limits applicable to devices that emit in the ultraviolet, visible, and infra- red spectra. Class IIIb products include laser systems ranging from 5 to 500 milliwatts in the visible spectrum. Class IIIb emission levels are oc- ular hazards for direct exposure throughout the range of the Class, and skin hazards at the higher levels of the Class.		
Class IV/4	Exceeding the limits of Class IIIb and are a hazard for scattered reflec- tion as well as for direct exposure.	A Class 4 laser is a hazard to the eye or skin from the direct beam and sometimes from a diffuse reflection and also can be a fire hazard. Class 4 lasers may also produce laser-generated air contaminants and hazard-ous plasma radiation.	

### **Label Indications**


• EN

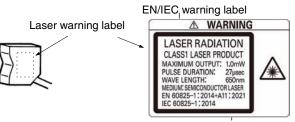

Explanatory label with specified wording

Note: Use of controls, adjustments, or procedures other than those specified herein may result in hazardous radiation exposure.

#### FDA

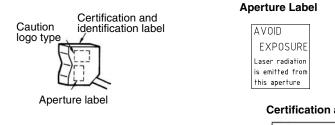

re Label	<b>Class II Caution</b>	logo type
	olass il odulloli	logo type




**Certification and Identification Label** 

This laser product complies with	
21 CFR 1040. 10 and 1040. 11.	
OMRON Corporation	
Shiokoji Horikawa,shimogyo-ku,	
Kyoto 600-8530 JAPAN	
Place of manufacture :	
AYABE Factory, OMRON Corp.	
Manufactured in	

Note: Use of controls, adjustments, or procedures other than those specified herein may result in hazardous radiation exposure.

(Unit: mm)

### Sensor Heads (Diffuse Reflective)

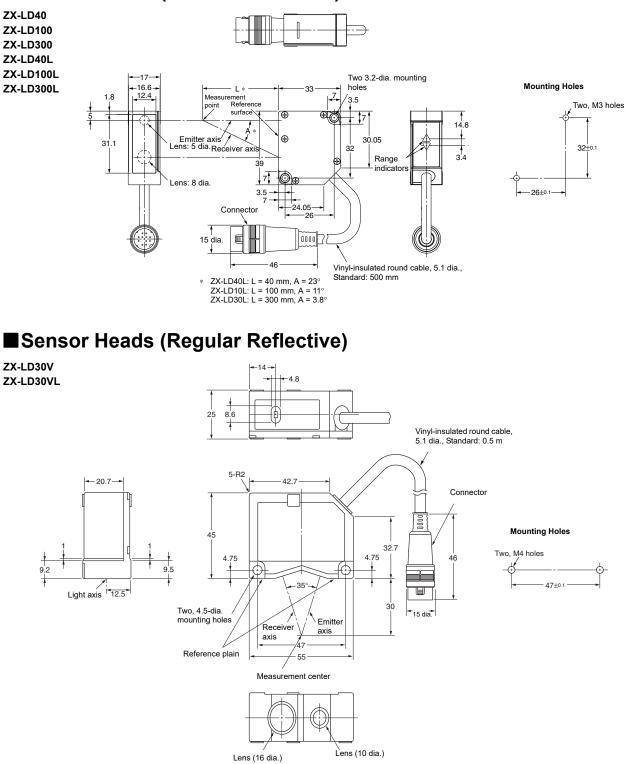

23

Vinyl-insulated round cable (black), 2.6 dia., Standard: 500 mm

Ð

Connector


Vinyl-insulated round cable (black), 2.6 dia., Standard: 500 mm

]7

Connector

**:** 

## Sensor Heads (Through-beam)

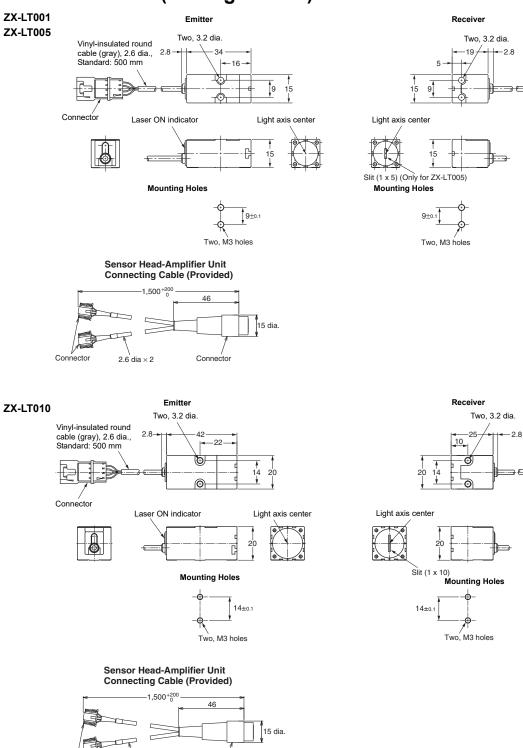


24 **ZX Series (ZX-L-N)** Smart Sensors (Laser Type)


Connector

Connector

2.6 dia  $\times 2$ 


#### ZX-LT030

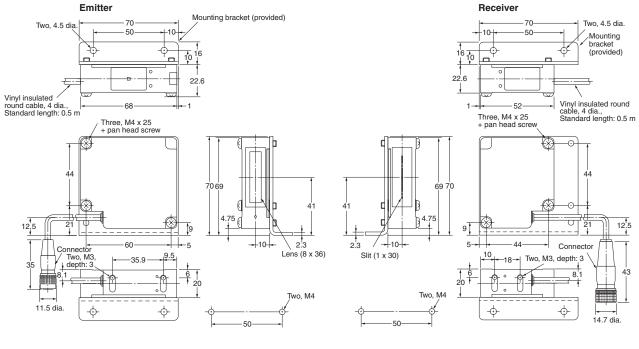

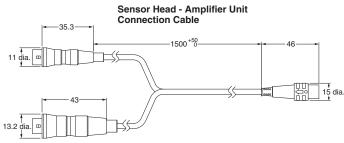


# Amplifier Units

ZX-LDA11-N ZX-LDA41-N

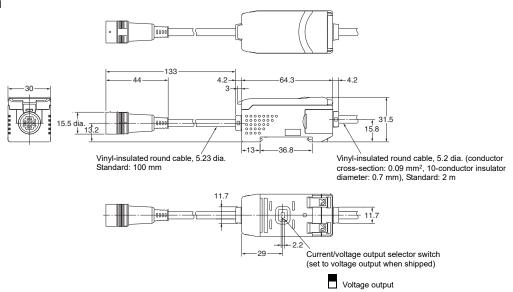

ZX Series (ZX-L-N) Smart Sensors (Laser Type)


# Accessories (Order Separately)

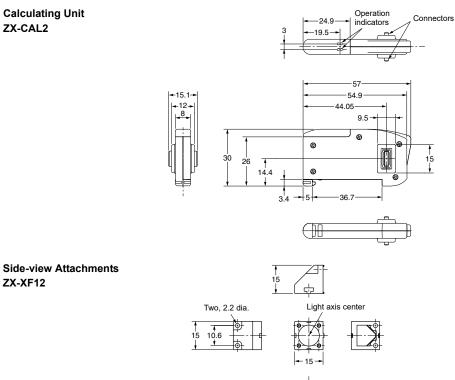


† 15 ↓ 2.7-

ZX-XF12

ZX-XF22

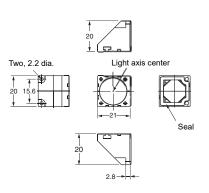

#### ZX-series Communications Interface Unit ZX-SF11

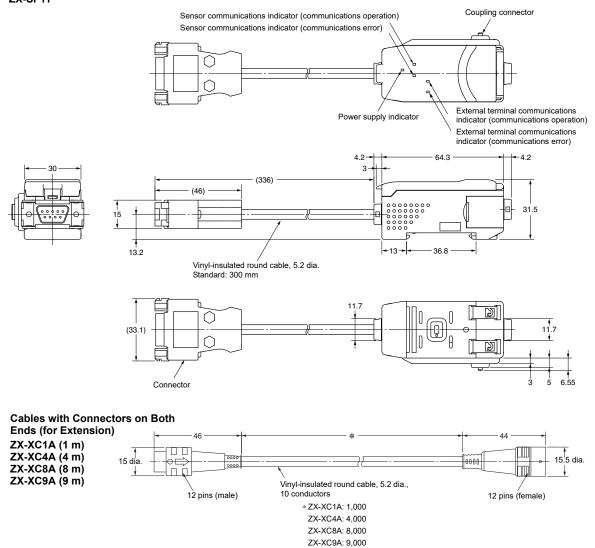

This document provides information mainly for selecting suitable models. Please read the document Z197 carefully for information that the user must understand and accept before purchase, including information on warranty, limitations of liability, and precautions.

Note: Do not use this document to operate the Unit.

OMRON Corporation Industrial Automation Company

Kyoto, JAPAN

Contact : www.ia.omron.com

#### **Regional Headquarters**

OMRON EUROPE B.V. Wegalaan 67-69, 2132 JD Hoofddorp The Netherlands Tel: (31) 2356-81-300 Fax: (31) 2356-81-388

OMRON ASIA PACIFIC PTE. LTD. 438B Alexandra Road, #08-01/02 Alexandra Technopark, Singapore 119968 Tel: (65) 6835-3011 Fax: (65) 6835-3011 
 OMRON ELECTRONICS LLC

 2895 Greenspoint Parkway, Suite 200

 Hoffman Estates, IL 60169 U.S.A.

 Tel: (1) 847-843-7900

 Fax: (1) 847-843-7787

OMRON (CHINA) CO., LTD. Room 2211, Bank of China Tower, 200 Yin Cheng Zhong Road, PuDong New Area, Shanghai, 200120, China Tel: (86) 21-6023-0333 Fax: (86) 21-5037-2388 Authorized Distributor:

©OMRON Corporation 2006-2025 All Rights Reserved. In the interest of product improvement, specifications are subject to change without notice. CSM\_1\_13 Cat. No. E349-E1-05 0625 (0606)