

Thru-beam sensor (pair) OBE20M-R101-S2EP-IO-IR



- Miniature design with versatile mounting options
- IO-Link interface for service and process data
- Various frequencies for avoiding mutual interference (cross-talk
- Extended temperature range -40 °C ... 60 °Ċ
- High degree of protection IP69K












Function

The miniature optical sensors are the first devices of their kind to offer an end-to- end solution in a small single standard design — from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

Dimensions

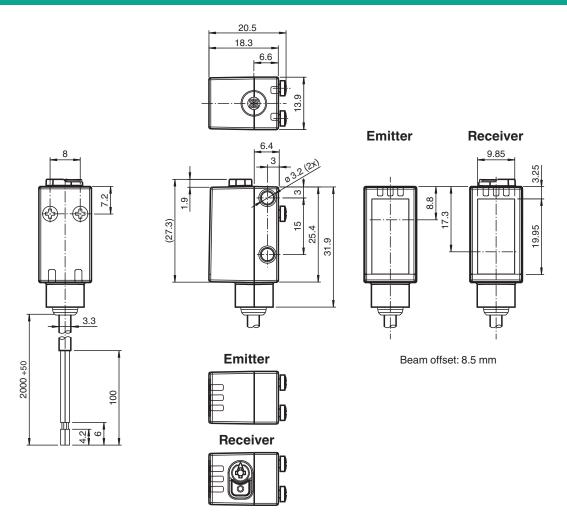





Technical Data

System components		
Emitter		OBE20M-R101-S-IO-IR
Receiver		OBE20M-R101-2EP-IO-IR
General specifications		
Effective detection range		0.2 20 m
Threshold detection range		25 m
Light source		LED
Light type		modulated infrared light 850 nm
LED risk group labelling		exempt group
Diameter of the light spot		approx. 100 mm at a distance of 1 m
Opening angle		5.4 °
Ambient light limit		EN 60947-5-2 : 30000 Lux
Functional safety related parameters		
MTTF _d		462 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0%
ndicators/operating means		V 70
· •		LED green:
Operation indicator		LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		Yellow LED: Permanently lit - light path clear Permanently off - object detected Flashing (4 Hz) - insufficient operating reserve
Control elements		Receiver: light/dark switch
Control elements		Receiver: sensitivity adjustment
Parameterization indicator		IO link communication: green LED goes out briefly (1 Hz)
Electrical specifications		10 link communication. green LLD goes out briefly (1112)
	- 11	10 30 V DC
Operating voltage	U _B	
Ripple No-load supply current	I ₀	max. 10 % Emitter: ≤ 14 mA Receiver: ≤ 13 mA at 24 V supply voltage
Protection class		III
nterface		
Interface type		IO-Link (via C/Q = pin 4)
IO-Link revision		1.1
Device ID		Emitter: 0x110401 (1115137) Receiver: 0x110301 (1114881)
Transfer rate		COM2 (38.4 kBit/s)
Min. cycle time		2.3 ms
Process data width		Emitter: Process data output: 2 Bit Receiver: Process data input: 2 Bit Process data output: 2 Bit
SIO mode support		yes
Compatible master port type		A
nput		
Test input		emitter deactivation at +U _B
Output		
Switching type		The switching type of the sensor is adjustable. The default setting is: C/Q - BK: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link /Q - WH: NPN normally closed / light-on, PNP normally open / dark-on
Signal output		2 push-pull (4 in 1) outputs, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC
Switching current		max. 100 mA, resistive load
Usage category		DC-12 and DC-13


Technical Data		
recinical Bata		
Voltage drop	U_d	≤ 1.5 V DC
Switching frequency	f	1000 Hz
Response time		0.5 ms
Directive conformity		
Electromagnetic compatibility		
Directive 2014/30/EU		EN 60947-5-2/A1:2012
Compliance with standards and directives		
Standard conformity		
Product standard		EN 60947-5-2:2007+A1:2012 IEC 60947-5-2:2007 + A1:2012
Standards		UL 60947-5-2: 2014 IEC 61131-9:2013 EN 62471:2008 EN 61131-9:2013
Approvals and certificates		
UL approval		E87056 , cULus Listed , class 2 power supply , type rating 1
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F) , fixed cable -25 60 °C (-13 140 °F) , movable cable not appropriate for conveyor chains
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		
Housing width		13.9 mm
Housing height		33.8 mm
Housing depth		18.3 mm
Degree of protection		IP67 / IP69 / IP69K
Connection		2 m fixed cable
Material		
Housing		PC (Polycarbonate)
Optical face		PMMA
Mass		Emitter: approx. 10 g receiver: approx. 10 g
Cable length		2 m

Connection



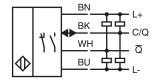


Emitter




1 Operating indicator


Receiver

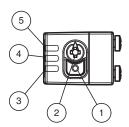

- 1 Light-on/dark-on changeover switch
- 2 Sensitivity adjuster
- 3 Operating indicator / light on
- 4 Signal indicator
- 5 Operating indicator / dark on

Characteristic Curve

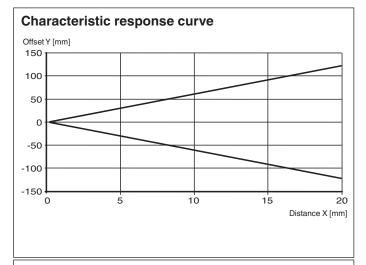

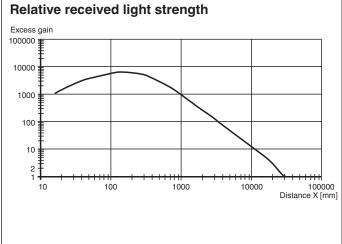

Accessories




OMH-R101


Mounting Clamp

OMH-R101-Front

Mounting Clamp



Accessories OMH-4.1 Mounting Clamp OMH-ML6 Mounting bracket OMH-ML6-U Mounting bracket OMH-ML6-Z Mounting bracket ICE2-8IOL-G65L-V1D EtherNet/IP IO-Link master with 8 inputs/outputs ICE3-8IOL-G65L-V1D PROFINET IO IO-Link master with 8 inputs/outputs ICE2-8IOL-K45S-RJ45 EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, screw terminal ICE3-8IOL-K45P-RJ45 PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, push-in terminals ICE3-8IOL-K45S-RJ45 PROFINET IO IO-Link master with 8 inputs/outputs, DIN rail, screw terminal IO-Link-Master02-USB IO-Link master, supply via USB port or separate power supply, LED indicators, M12 plug for sensor connection ICE1-8IOL-G30L-V1D Ethernet IO-Link module with 8 inputs/outputs ICE1-8IOL-G60L-V1D Ethernet IO-Link module with 8 inputs/outputs ICE2-8IOL-K45P-RJ45 EtherNet/IP IO-Link master with 8 inputs/outputs, DIN rail, push-in connectors

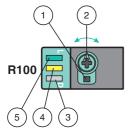

- 1 Light-on / dark-on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range /sensitivity adjuster for more than 180 degrees.

Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range /sensitivity adjuster for more than 180 degrees.