

HD4141

1. USE

German standard socket outlet.
Mechanism supplied with front cover.
Mechanism to be completed with cover plates and supports.
Flush or wall mounting.


2. RANGE

	Designation	Cat. No.
	2 P+E 16 A 250 V socket with earth side contacts Shielded tulip contacts	<input type="checkbox"/> HD4141 <input checked="" type="checkbox"/> HC4141 <input checked="" type="checkbox"/> HS4141
	2 P+E 16 A 250 V socket with earth side contacts Shielded tulip contacts Red color	<input type="radio"/> H4141R
	2 P+E 16 A 250 V socket with earth side contacts Shielded tulip contacts	<input type="checkbox"/> HD4141W <input checked="" type="checkbox"/> HC4141W <input checked="" type="checkbox"/> HS4141W
	2 P+E 16 A 250 V socket with earth side contacts Shielded tulip contacts With cover	<input type="checkbox"/> HD4141PW <input checked="" type="checkbox"/> HC4141PW <input checked="" type="checkbox"/> HS4141PW
	2 P+E 16 A 250 V socket with earth side contacts Shielded tulip contacts Red color exclusive uses	<input type="radio"/> H4141RW

Color code:

White Anthracite
 Tech Neutral article

3. OVERALL DIMENSIONS

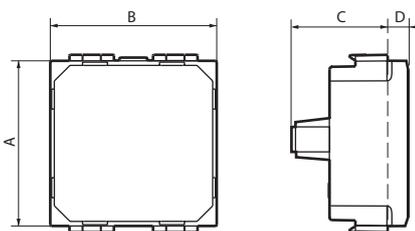

3. OVERALL DIMENSIONS (continued)

References	A	B	C	D
HD/HC/HS4141 H4141R	44	44	37.5	9.5
HD/HC/HS4141W HD/HC/HS4141PW H4141RW	44	44	34	9.5

4. CONNECTION

Screw terminals:

Terminal capacity: 2.5 mm²
Stripping length: 11 mm

Screwless terminals for Cat. Nos: HD/HC/HS4141W - HD/HC/HS4141PW H4141RW

Terminal capacity: 2.5 mm²
Stripping length: 13 mm

5. TECHNICAL CHARACTERISTICS

■ 5.1 Protection index

Penetration by solid bodies/liquid: IP 21
Impact test: IK 04

■ 5.2 Material characteristics

Satin appearance.

Material:

- Socket front cover: Polycarbonate
- Halogen free

Self extinguishing:

- + 850° C / 30 s for insulating parts holding live parts in place.
- + 650° C / 30 s for other parts made of insulating materials.

UV resistant.

■ 5.3 Electrical characteristics

Voltage: 250 VAC

Current: 16 A

■ 5.4 Climatic characteristics

Storage and operating temperatures: - 5° C to + 35° C

6. CLEANING

Surface cleaning with a cloth.

Do not use: acetone, tar remover, trichloroethylene.

Caution: A preliminary test should be carried out if other specific cleaning products are to be used.

7. STANDARDS AND APPROVALS

Compliance with standards of installation and manufacturing.

Refer to e.catalogue.