# Triangulation sensor (BGE) OBT100-R100-2EP-IO-V31-1T-L



- Miniature design with versatile mounting options
- Secure and gapless detection, even near the surface through background evaluation
- DuraBeam Laser Sensors durable and employable like an LED
- Extended temperature range -40 °C ... 60 °Ċ
- High degree of protection IP69K
- IO-Link interface for service and process data

Laser diffuse mode sensor with background evaluation











#### **Function**


The R100 series miniature optical sensors are the first devices of their kind to offer an endto- end solution in a small single standard design from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.

The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

### **Dimensions**

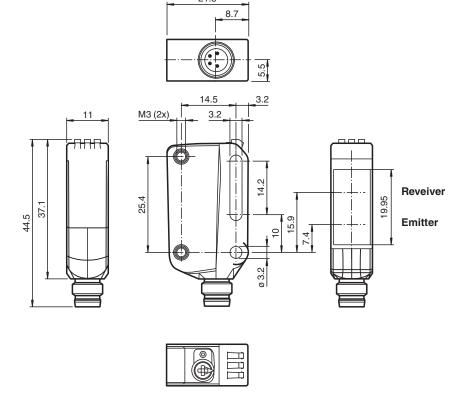


Technical Data

#### **General specifications** 7 ... 100 mm **Detection range** Detection range min. 7 ... 25 mm Detection range max. 7 ... 100 mm Adjustment range 25 ... 100 mm standard white, 100 mm x 100 mm Reference target Light source laser diode modulated visible red light Light type Laser nominal ratings LASER LIGHT, DO NOT STARE INTO BEAM Note Laser class Wave length 680 nm Beam divergence > 5 mrad d63 < 1 mm in the range of 150 mm ... 250 mm Pulse length Repetition rate approx. 13 kHz max. pulse energy 10.4 nJ < 5 % at 150 mm Black-white difference (6 %/90 %) Diameter of the light spot < 1 mm at a distance of 60 mm Opening angle approx. 0.3° Ambient light limit EN 60947-5-2: 40000 Lux Functional safety related parameters MTTF<sub>d</sub> 560 a Mission Time (T<sub>M</sub>) 20 a Diagnostic Coverage (DC) 0 % Indicators/operating means Operation indicator LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode Function indicator LED vellow: constantly on - background detected (object not detected) constantly off - object detected Control elements Light-on/dark-on changeover switch Control elements Sensing range adjuster **Electrical specifications** Operating voltage $U_{\mathsf{B}}$ 10 ... 30 V DC Ripple max. 10 % No-load supply current < 20 mA at 24 V supply voltage $I_0$ Protection class Interface Interface type IO-Link (via C/Q = pin 4) IO-Link revision Device profile **Smart Sensor** Device ID 0x110703 (1115907) Transfer rate COM2 (38.4 kBit/s) Min. cycle time 2.3 ms Process data width Process data input 1 Bit Process data output 2 Bit SIO mode support yes Compatible master port type Α Output The switching type of the sensor is adjustable. The default setting is: C/Q - Pin4: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link /Q - Pin2: NPN normally closed / light-on, PNP normally open / dark-on Switching type 2 push-pull (4 in 1) outputs, short-circuit protected, reverse polarity protected, Signal output overvoltage protected

Technical Data		
Switching voltage		max. 30 V DC
Switching current		max. 100 mA, resistive load
Usage category		DC-12 and DC-13
Voltage drop	$U_{d}$	≤ 1.5 V DC
Switching frequency	f	1650 Hz
Response time		300 µs
Conformity		
Communication interface		IEC 61131-9
Product standard		EN 60947-5-2
Laser safety		EN 60825-1:2014
Approvals and certificates		
UL approval		E87056, cULus Listed, class 2 power supply, type rating 1
FDA approval		IEC 60825-1:2014 Complies with 21 CFR 1040.10 and 1040.11 except for conformance with IEC 60825-1 Ed. 3 as described in Laser Notice 56, dated May 8, 2019.
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 70 °C (-40 158 °F)
Mechanical specifications		
Degree of protection		IP67 / IP69 / IP69K
Connection		M8 x 1 connector, 4-pin
Material		
Housing		PC (Polycarbonate)
Optical face		PMMA
Mass		approx. 10 g
Dimensions		
Height		44.5 mm
Width		11 mm
Depth		21.5 mm

## **Connection Assignment**

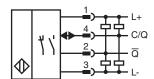

## **Connection Assignment**




### **Connection Assignment**


Wire colors in accordance with EN 60947-5-2


1 BN (brown) 2 WH (white) 3 BU (blue) 4 BK (black)

### **Assembly**

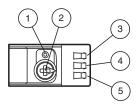

- 1 Light-on / dark-on changeover switch
- 2 Sensing range adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

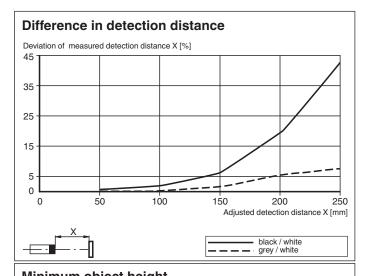

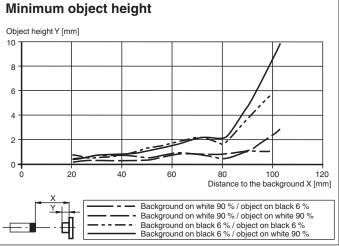

### **Safety Information**




#### CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified. Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

### CLASS 1 LASER PRODUCT

IEC 60825-1: 2007 certified.
Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 50, dated June 24, 2007

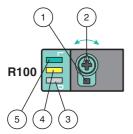

- 1 Light-on / dark-on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range /sensitivity adjuster for more than 180 degrees.

### Sensing Range / Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

#### **Light-on / Dark-on Configuration**

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

### **Restore Factory Settings**

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range /sensitivity adjuster for more than 180 degrees.