

Laser retroreflective sensor OBR12M-R103-2EP-IO-L



- Miniature design with versatile mounting options
- DuraBeam Laser Sensors durable and employable like an LED
- Extended temperature range -40 $^{\circ}\text{C}$... 60 $^{\circ}\text{C}$
- High degree of protection IP69K
- IO-Link interface for service and process data

Laser retroreflective sensor











Function


The R103 series miniature optical sensors are the first devices of their kind to offer an endto- end solution in a small single standard design from thru-beam sensor through to a distance measurement device. As a result of this design, the sensors are able to perform practically all standard automation tasks.


The entire series enables sensors to communicate via IO-Link.

The DuraBeam laser sensors are durable and can be used in the same way as a standard sensor.

The use of Multi Pixel Technology gives the standard sensors a high level of flexibility and enables them to adapt more effectively to their operating environment.

Dimensions

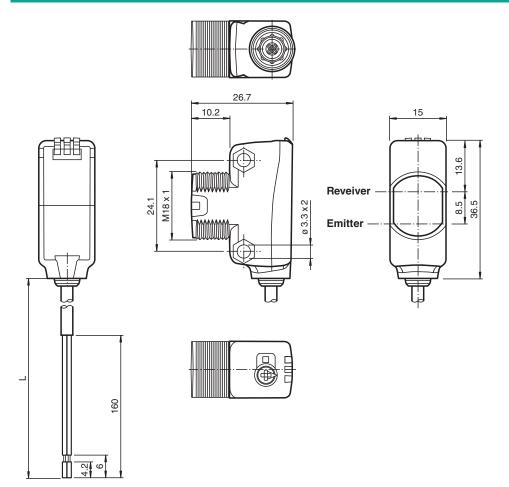

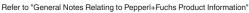


Release date: 2025-01-30 Date of issue: 2025-01-30 Filename: 267075-100297_eng.pdf

Technical Data


General specifications		
Effective detection range		0 12 m
Reflector distance		0.25 12 m
Threshold detection range		15 m
Reference target		H50 reflector
Light source		laser diode
Light type		modulated visible red light
Polarization filter		yes
Laser nominal ratings		
Note		LASER LIGHT , DO NOT STARE INTO BEAM
Laser class		1
Wave length		680 nm
Beam divergence		> 5 mrad d63 < 2 mm in the range of 250 mm 750 mm
Pulse length		1.6 µs
Repetition rate		max. 17.6 kHz
max. pulse energy		9.6 nJ
Diameter of the light spot		approx. 30 mm at a distance of 12 m
Opening angle		approx. 0.3 °
Ambient light limit		EN 60947-5-2
Functional safety related parameters		
MTTF _d		672 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
ndicators/operating means		
Operation indicator		LED green: constantly on - power on flashing (4Hz) - short circuit flashing with short break (1 Hz) - IO-Link mode
Function indicator		Yellow LED: Permanently lit - light path clear Permanently off - object detected Flashing (4 Hz) - insufficient operating reserve
Control elements		Light-on/dark-on changeover switch
Control elements		sensitivity adjustment
Parameterization indicator		IO link communication: green LED goes out briefly (1 Hz)
Electrical specifications		
Operating voltage	U _B	10 30 V DC
Ripple		max. 10 %
No-load supply current	Io	< 20 mA at 24 V supply voltage
Protection class		
Interface		
Interface type		IO-Link (via C/Q = pin 4)
IO-Link revision		1.1
Device ID		0x110205 (1114629)
Transfer rate		COM2 (38.4 kBit/s)
Min. cycle time		2.3 ms
Process data width		Process data input 2 Bit Process data output 2 Bit
SIO mode support		yes
Compatible master port type		A
Output		
Switching type		The switching type of the sensor is adjustable. The default setting is: C/Q - BK: NPN normally open / dark-on, PNP normally closed / light-on, IO-Link /Q - WH: NPN normally closed / light-on, PNP normally open / dark-on
Signal output		2 push-pull (4 in 1) outputs, short-circuit protected, reverse polarity protected, overvoltage protected
Switching voltage		max. 30 V DC

$\begin{array}{lll} \mbox{Usage category} & \mbox{DC-12 and DC-13} \\ \mbox{Voltage drop} & \mbox{U}_d & \leq 1.5 \mbox{ V DC} \\ \mbox{Switching frequency} & \mbox{f} & 2000 \mbox{ Hz} \\ \mbox{Response time} & 250 \mu \mbox{S} \end{array}$	
Voltage drop $ \begin{array}{ccc} U_d & \leq 1.5 \text{ V DC} \\ \\ \text{Switching frequency} & \text{f} & 2000 \text{ Hz} \\ \\ \text{Response time} & 250 \mu\text{s} \\ \end{array} $	
Switching frequency f 2000 Hz Response time 250 µs	
Response time 250 µs	
·	
Conformity	
Communication interface IEC 61131-9	
Product standard EN 60947-5-2	
Laser safety EN 60825-1:2014	
Approvals and certificates	
UL approval E87056, cULus Listed, class 2 power supply, type rating 1	
FDA approval IEC 60825-1:2014 Complies with 21 CFR 1040.10 and 1040.11 exc conformance with IEC 60825-1 Ed. 3 as described in Laser Notice 5 2019.	cept for 56, dated May 8,
Ambient conditions	
Ambient temperature -40 60 °C (-40 140 °F) , cable, fixed installation -25 60 °C (-13 140 °F) , movable cable not appropriate for conv	veyor chains
Storage temperature -40 70 °C (-40 158 °F)	
Mechanical specifications	
Degree of protection IP67 / IP69 / IP69K	
Connection 2 m fixed cable	
Material	
Housing PC (Polycarbonate)	
Optical face PMMA	
Mass approx. 38 g	
Dimensions	
Height 36.5 mm	
Width 15 mm	
Depth 26.7 mm	
Cable length 2 m	

Connection

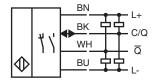



Assembly

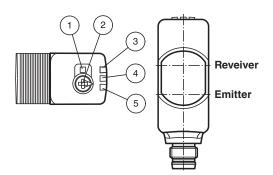

- 1 Light-on/dark-on changeover switch
- 2 Sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Function indicator
- 5 Operating indicator / light on

Characteristic Curve

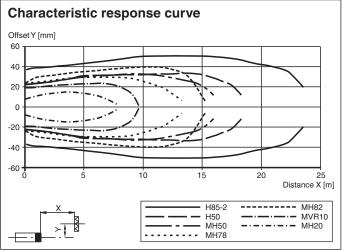

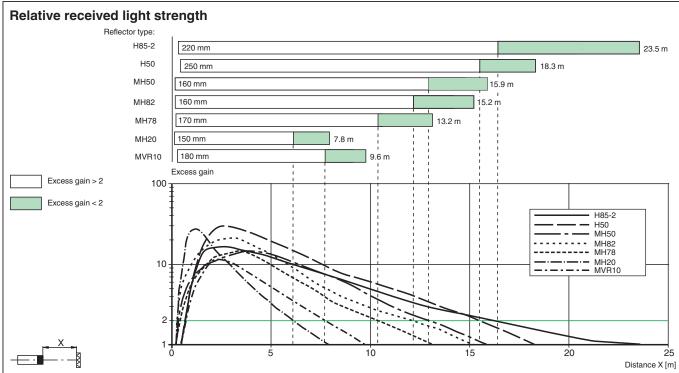

- 1 Light-on / dark-on changeover switch
- 2 Sensing range / sensitivity adjuster
- 3 Operating indicator / dark on
- 4 Signal indicator
- 5 Operating indicator / light on

To unlock the adjustment functions turn the sensing range adjuster / sensitivity adjuster for more than 180 degrees.

Sensing Range/ Sensitivity

Turn sensing range / sensitivity adjuster clockwise to increase sensing range / sensitivity.

Turn sensing range / sensitivity adjuster counter clockwise to decrease sensing range / sensitivity.

If the end of the adjustment range is reached, the signal indicator starts flashing with 8 Hz.

Light-on / Dark-on Configuration

Press the light-on / dark-on changeover switch for more than 1 second (less than 4 seconds). The light-on / dark-on mode changes and the operating indicators are activated accordingly.

If you press the light-on / dark-on changeover switch for more than 4 seconds, the light-on /dark-on mode changes back to the original setting. On release of the light-on / dark-on changeover switch the current state is activated.

Restore Factory Settings

Press the light-on / dark-on changeover switch for more than 10 seconds (less than 30 seconds) until all LEDs turn off. On release of the light-on / dark-on changeover switch the signal indicator turns on. After 5 seconds the sensor resumes operation with factory default settings.

After 5 minutes of inactivity the sensing range / sensitivity adjustment is locked. In order to reactivate the sensing range / sensitivity adjustment, turn the sensing range / sensitivity adjuster for more than 180 degrees.